



Elcometer 319 Dewpoint Meter

Climatic Conditions

Elcometer 319

Dewpoint Meter

This rugged gauge is designed to measure and record all relevant climatic parameters required to determine whether the conditions are suitable for painting.



elcometer -

Climatic Conditions

Elcometer 319



Robust temperature sensors





Climatic Conditions

Elcometer 319

Dewpoint Meter

Durable

IP66

life

Versatile

Software[†]

the USB cable

Rapid response time

· Safe use in climates ranging between

· Waterproof and dust proof rating equivalent to

· Rugged and ergonomic design, re-engineered

· Data can be downloaded to a PC via USB or

Bluetooth® and evaluated using ElcoMaster®

Each gauge can be powered by either 2 AA

batteries (for up to 400 hours# use) or directly via

parameter which trigger visual and audible

Intelligent memory calculates total available

· Gauges can be recertified at Elcometer

· Adjustable limits can be set for each measurement

alarms whenever a limit is exceeded

logging time when using batches

Authorised Service Centres

sensors have greater durability for an extended

-20°C (-4°F) and +80°C (+176°F)

Accurate

- Meets ISO 8502-4
- · Each instrument is supplied with a Calibration Certificate
- · Readings are switchable between Celsius and Fahrenheit
- All readings are time & date stamped

Simple

- Easy menu-driven user interface in multiple languages
- · Clear, illuminated display showing up to five user-defined parameters
- Arrow indicators show temperature trends

Flexible


- The gauge can be used as either a hand-held Dewpoint meter or as a remote data logging monitor[†]
- Integrated K-Type connector allows measurement of surface temperature during remote logging using a remote probe
- · Using an external probe the "Te" mode transforms the gauge into a thermometer - ideal for measuring temperature of a paint prior to application
- Hold/freeze function allows manual readings to be reviewed before being added into the memory



Te - Ideal for use as a simple thermometer



Waterproof and rugged to IP66

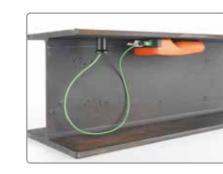

*Based on 1 reading every 10 minutes in logging mode.

[†] Model T only.

Remote monitoring of climatic parameters

Dewpoint Meter

Technical Specification	
Model	
Part Number	
Reading Parameters - RH, Ta, TS, Td, T∆, Tdb, Twb ¹ , SH	1
Statistics - number of readings, standard deviation, mean, coefficient of variation, minimum, maximum	
Dustproof & Waterproof Gauge with Fully Sealed Sensors - equivalent to IP66	
Integral Magnets - secure the gauge during logging	
High/Low Limits - audible, visual, red/green LED alarms can be set against any or all parameters	
Multilingual Menus	
Backlight - user selectable	
K-Type Connector for External Measurement	
Memory - with reading and statistic review	
Manual Logging	
Interval Logging ²	
Data Output	
USB	
Bluetooth [®] to computer, Android [™] & iOS [‡] devices	
ElcoMaster® software & USB cable	
Certificate	
	Те
Gauge ¹	-2
Air Temperature (Ta)	-2
Surface Temperature (TS)	-2
External K-Type Thermocouple (Te)	-4(
Relative Humidity (RH)	0 t
Gauge & LCD Operating Range	-2
Power Supply	2 :
Battery Life	Ma Int
Dimensions 180 x 75 x 35mm (7 x 3 x 1.4")	W
Packing List	Ele
	ca
	ins
Accessories	
///////////////////////////////////////	

Accessories	
T31920162	Magnetic Surface Temperature Probe; -4
T9996390-	Liquid Temperature Probe; -200 to +1100
T99921325	USB Cable
T99916063	Wrist Strap
T99923480	Protective Carry Case/Pouch
Cortificate auguliad as at	andord

Certificate supplied as standard

¹Calculated Value ²With Part Number T31920162

⁴ Visit www.elcometer.com/sdk to find out how to integrate Elcometer's MFi certified products to your App.

[!] Do not expose the gauge to temperatures outside the gauge and LCD operating range

* Accuracy ±2°C (4°F) with K Type probes supplied by Elcometer. Probes supplied by other manufacturers may vary Model T only

elcometer.com

elcometer

4

Climatic Conditions

Elcometer 319

		С
Model S		odel T
G319S	G319T	
		-
Last 10 records	25,000 recor	ds in 999 batches
	Adjustable between	n 1 second and 1 hour
•		•
emperature Range	Accuracy	Resolution
20 to +80°C (-4 to +176°F)	±0.5°C (±1°F)	0.1°C (0.1°F)
20 to +80°C (-4 to +176°F)	±0.5°C (±1°F)	0.1°C (0.1°F)
20 to +80°C (-4 to +176°F)	±0.5°C (±1°F)	0.1°C (0.1°F)
40 to +200°C (-40 to+392°F)	±0.5°C (±1°F)*	0.1°C (0.1°F)
to 100%RH	±3%RH	0.1%
20°C to +80°C (-4°F to +176°	F)	
x AA batteries or via USB Ca	able	
lanual Mode: Greater than 40 hterval Logging: up to 400 ho		
Veight	300g (0.66lb)	
Icometer 319 Dewpoint Mete ase, calibration certificate, US astructions		
40 to +80°C (-40 to +176°F)		
0°C (-328 to +2012°F)		

Climatic Conditions

Elcometer 319 Dewpoint meter

Dewpoint meter

................

Create instant reports with ElcoMaster®

USB

🚯 Bluetooth

What you do with the collected data is just as important as taking the readings themselves.

ElcoMaster[®] is a fast, easy to use software solution for all your data management and quality assurance needs, preparing professional inspection reports at the click of a button.

Data transferred to ElcoMaster[®] includes;

21.9

- RH, Ta, TS, Td<mark>, TΔ, Tdb, Twb, SH re</mark>adings
- Date & time for each reading
- Batch information & statistics

Whether you are in the field or on the factory floor, using the ElcoMaster[®] Mobile App users can;

- 0

- Store live readings directly on to a mobile device and save them into batches
- View graphs in real-time whilst carrying out the inspection
- Add notes to individual batch reading
- Add photographs of the test surface to each individual batch reading at the click of a button
- Plot individual readings on to a location Map photograph or diagram via the mobile device's internal GPS
- Inspection data can be transferred from mobile to
 PC for further analysis and reporting
- · Generate instant .pdf report for submission

Google play

PDF

Fmail

Stropbox 💦 Google Drive

Climatic Conditions

Connect

Connect gauge via Bluetooth[®] to see live readings directly on the phone and save them into batches.

Review

Review average, maximum and minimum readings instantly.

Manage & Print

Store all data; gloss, dry film thickness, surface profile, climate and manual reports in easy to manage folders.

Photos & Notes

Add photos, notes and comments.

Image Collection

Use measurement location points on images to indicate the position for the next reading.

Combine

Combine different inspection parameters (such as climate, DFT, surface profile, surface cleanliness and adhesion) together with images, notes and other project specific information into reports.


Collaborate

Share inspection data securely via the Cloud and collaborate on projects using the instant messaging feature in ElcoMaster®.

Send

Email inspection data from a mobile device to a PC for further analysis and reporting or transfer data via the Cloud.

Elcometer 319











ENGLAND

Elcometer Limited Manchester M43 6BU Tel: +44 (0)161 371 6000 Fax: +44 (0)161 371 6010 sales@elcometer.com

BELGIUM

Elcometer SA B-4681 Hermalle /s Argenteau Tel: +32 (0)4 379 96 10 Fax: +32 (0)4 374 06 03 be_info@elcometer.com

FRANCE

Elcometer Sarl 45380 La Chapelle-Saint-Mesmin Tel: +33 (0)2 38 86 33 44 Fax: +33 (0)2 38 91 37 66 fr_info@elcometer.com

GERMANY

Elcometer Instruments GmbH D-73431 Aalen Tel: +49(0)7361 52806 0 Fax: +49(0)7361 52806 77 de_info@elcometer.de

THE NETHERLANDS

Elcometer NL Euclideslaan 251 3584 BV Utrecht Tel: +31 (0)30 259 1818 Fax: +31 (0)30 210 6666 nl_info@elcometer.com

JAPAN

Elcometer KK Saint Paul Building, 6F, 5-14-11,Higashiooi, Shinagawa-ku,Tokyo 140-0011 Tel: +81-(0)3-6869-0770 Fax: +81-(0)3-6433-1220 jp_info@elcometer.com

REPUBLIC OF SINGAPORE

Elcometer (Asia) Pte Ltd Singapore 589472, Tel: +65 6462 2822 Fax: +65 6462 2860 asia@elcometer.com

USA

MICHIGAN Elcometer Inc Rochester Hills Michigan 48309 Tel: +1 248 650 0500 Toll Free: 800 521 0635 Fax: +1 248 650 0501 inc@elcometer.com

TEXAS

Elcometer of Houston 1146 Sheffield, Unit D, Houston, TX 77015 Tel: +1 713 450 0631 Toll Free: 800 521 0635 Fax: +1 713 450 0632 inc@elcometer.com

elcometer.com

Elcometer 319 Model T: Made for iPhone 6 Plus, iPhone 6, iPhone 5s, iPhone 5c, iPhone 5s, iPhone 4s, iPad Air 2, iPad Air 2, iPad Mini 3, iPad Air, iPad mini 2, iPad (3rd and 4th generation), iPad mini, iPad 2, and iPad for (4th and 5th generation). Wade for iPone, "Made for iPhone," and "Made for iPad" mean that an electronic accessory has been designed to connect specifically to IPod touch, iPhone, or iPad, respectively, and has been certified by the developer to meet Apple performance standards. Apple is not responsible for the operation of this device or its compliance with safety and regulatory standards. Please note that the use of this accessory with iPod touch, iPhone, or iPad may affect wireless performance. iPad, iPad,

All rights reserved. No part of this document may be reproduced, transmitted, stored (in a retrieval system or otherwise), or translated into any language, in any form, or by any means, without the prior written permission of Elcometer Limited. Elcometer and ElcoMaster[®] are registered trademarks of Elcometer Limited. All other trademarks are acknowledged. Due to our policy of continuous improvement, Elcometer Limited reserves the right to change specifications without notice. All gauges come with a 1 year warranty as standard, the Elcometer 319 is extendable within 60 days from date of purchase, free of charge, to 2 years via www. elcometer.com